

## **Advantech AE Technical Share Document**

Date	2020 / 04/27	Release Note	□ Internal ■ External		
Category	■FAQ □SOP	Related OS	Embedded Windows 10		
Abstract	The license of embedded Windows 10 IoT cannot be activated by Microsoft				
Keyword	Activation, Windows 10, License				
<b>Related Product</b>	All ASG products				

## Problem Description:

According to our investigation, if the user have the following use cases, the pre-installed product key will be automatically replaced and activation will fail.

- 1. If the user has not activated the OS for a period of time, the product key will be replaced when the network is connected for the first time.
- 2. If the user presses the "Troubleshoot" icon before activating the OS, product key will be replaced and the activation will fail.

		tivate windows.
	ጽ	へ 記 (19) 8:27 AM 3/16/2020
Activati	ion	
		Where's my product key?
Windows	Windows 10 Enterprise LTSC	Depending on how you got Windows,
Activation	Windows is not activated	activation will use a digital license or a product key.
Product ID	00424-80200-00000-AAOEM	Get more info about activation
Product Key	XXXXX-XXXXX-XXXXXX-F9D8M	
valid digital lie	vate Windows on this device because you don't hav cense or product key. If you think you do have a va , select Troubleshoot below. Error code: 0xC004C00	lid
	ng problems with activation, select Troubleshoot to	
C Troubles	hoot	
Activate V	Windows now	
	n-genuine copy of Windows can put you at greater ther security threats.	risk for
To get genuin	e Windows, enter a different product key. If you do	n't have
	your system administrator.	



Correct		Incorrect	
Windows 版本 啟用	Windows 10 企業版 LTSC Windows 已飲用	Windows 版本 啟用	Windows 10 企業版 LTSC Windows 未敢用
產品識別碼 產品金鑰	00424-80200-00845-AAOEM XXXXX-XXXXX-XXXXXX-XXXXXX-JXXXXX-JXXXXX-XXXXXX	產品識別碼	00424-80200-00000-AAOEM
室田主墳 2000-2000-2000-2000 更新產品金鑰 若要在此裝置上使用其他產品金鑰,調選取[變更產品金鑰]。		產品金鑰 XXXX-XXXXX-XXXXX-XXXXX <mark>1-F9DBM</mark> 我們無法在此裝置上敵用 Windows,因為您不具有有效的數位授權或產 品金鑰。如果您認為您擁有有效的授權或金鑰,請選取下方的「疑難排 解」。 鐳誤碼: 0xC004C003 若您有敵用問題,請選取 [疑難排解] 以嘗試並修正問題。	
♀ 變更產品金鑰		<b>19</b> 疑難排解	

## Brief Solution:

Microsoft has released 2 patches in February 25 to fix the issue. If the problem has already occurred, installing these patches will not solve the problem. The patches needs to be installed before the issue occurs. If the problem has occurred, please reinstall the OS, and then install two patches to prevent the problem from recurring.

KB4537818 download <u>http://catalog.update.microsoft.com/v7/site/Search.aspx?q=KB4537818</u> KB4523204 download <u>http://catalog.update.microsoft.com/v7/site/Search.aspx?q=KB4523204</u>

## February 25, 2020—KB4537818 (OS Build 17763.1075)

Applies to: Windows 10, version 1809, all editions, Windows Server version 1809, Windows Server 2019, all editions

Release Date: Version: February 25, 2020 OS Build 17763.1075

For Advantech Embedded images, we have included the above fixes starting with V6.05.

Reference: <u>https://support.microsoft.com/en-us/help/4537818/windows-10-update-kb4537818</u>