

Advantech AE Technical Sharing Documentation

Date	2022/11/03	SR#	
Category	■FAQ □SOP	Related OS	
Abstract	ARK-7060, How to detect AIW-355 on ARK-7060?		
Keyword	ARK-7060, AIW-355, Detection		
Related Product	ARK-7060, AIW-355		

■ Problem Description:


AIW-355 cannot be detected on ARK-7060. There is no device detected when installing AIW-355.




■ **Answer:**

Please set M2_SEL2 to 2-3 pin,

M2_SEL2 M.2 select function source setting	
Part Number	1653003101
Foot Print	HD_3x1P_79_D
Description	PIN HEADER 3x1P 2.0mm 180D(M) DIP 2000-13 WS
Setting	Function
(1-2)	Auto detect by card (Default)
(2-3)	USB3.0
Floating	PCIE

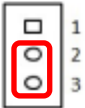

And you can find the new devices in device manager.

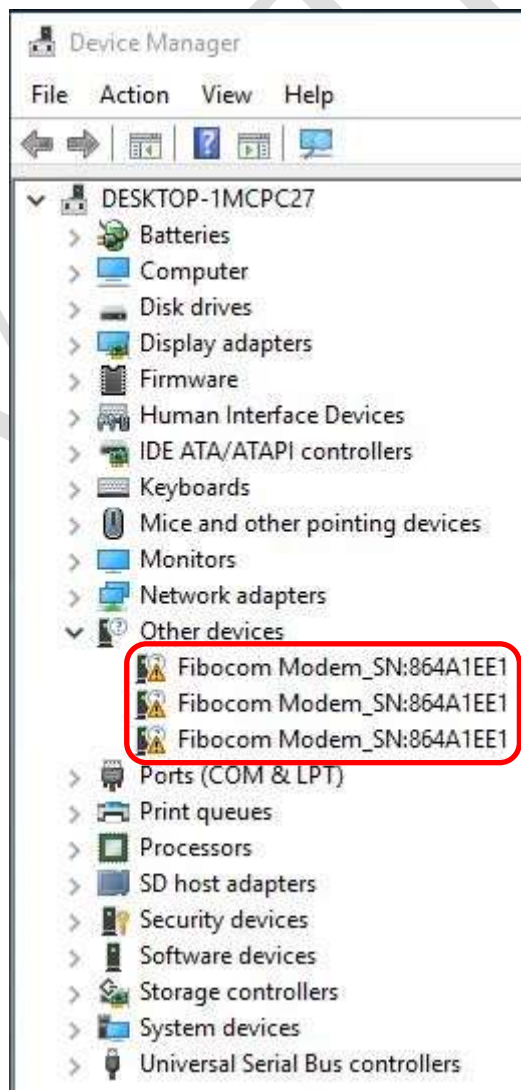

After installing driver for AIW-355, the “Generic Mobile Broadband Adaptor” will show in
“Device Manager > Network adapters”

